



# FedEx Package Test Report

WO-00080184

## Test Information

---

**Account Number** 268952306-EAN  
**Company** TEA FORTE INC  
**Contact** Sharon Yasevac  
**Completed Date** 8/28/2024 10:42:00 AM  
**Product Description** TOI Pitcher + TOI Sampler  
**Current or Prototype** Current  
**Test Procedure** ISTA 6-FEDEX-A TEST



## Testing Summary & Recommendations

---

PASSED TEST

This package has passed all testing conducted with no product damage or packaging failure.

---

### Definition of Results

**PASS:** A package, with article, that has passed all the FedEx Standard Testing Procedures. For commodities restricted under Liabilities Not Assumed in the FedEx Service Guide, Service Guide Terms and Conditions will take precedence.

**FAIL:** A package, with article, that has failed all FedEx Standard Testing Procedures.

**PENDING CUSTOMER REVIEW:** A package, with article, that has been tested to all FedEx Standard Test Procedures. Confirmation of results is subject to customer inspection.

**SEE COMMENTS ONLY:** A package, with article, that has been partially tested to a FedEx Standard Test Procedure or tested to a specific customer request such as Do Not Open. This status is treated similarly as a Failed package.

## Service Information

---

FedEx Lab Technician	Cody Surwic	Received Date	8/27/2024
FedEx Field Engineer	Edward Macdonald	Completed Date	8/28/2024 10:42:00 AM
Ship Method	FXG	Test Result Valid	8/28/2027

## Product Information

---

Product Description	TOI Pitcher + TOI Sampler
Model Number	SKU# 711801 + 16712
Commodity	GLASSWARE
Product Value	\$34

## Packaging Information

---

Package Length (in.)	12.00	Package Width (in.)	10.00
Package Height (in.)	8.75	Package Weight (lb.)	3.00
Outer Container	Corrugated Box	Corrugated Box	RSC (regular slotted container)
Flute Type	C	Other Outer Info	
Top Sealing Method	Tape, 2" plastic	Bottom Sealing	Tape, 2" plastic
Inner Packaging	Bubblewrap;Molded Pulp inserts;Paperboard Box		
Inner Pkg Remarks	Product was packaged inside a molded pulp insert then placed into a paperboard box then placed into the outer box with bubblewrap as void fill		

## Post Inspection

---


Inspection Notes	No visible damage
------------------	-------------------

## Test Procedures Completed

Package Type	Standard	Initial or Retest	Initial
	<b>Precondition</b>	Standard	12 hrs. Default= 23 C and 50% RH. No calculations required No observed package failures
	<b>Shock</b>	Standard	10 Drops from 30 inches. No calculations required No Product Damage
	<b>Compression</b>	Apply Release	Apply target load to Package Height Target Load: 250.11 Reached 251.6 lbs, 0.19" deflection
	<b>Vibration</b>	Rotary	30 min in primary orientation 30 min in second orientation No Product Damage

Our provision of advice, assistance or guidance on the appropriate packaging of shipment does not constitute acceptance of liability, unless such advice, assistance or guidance is in writing from the FedEx Packaging Lab and expressly accepts liability in the event of a damaged shipment.


# Photos

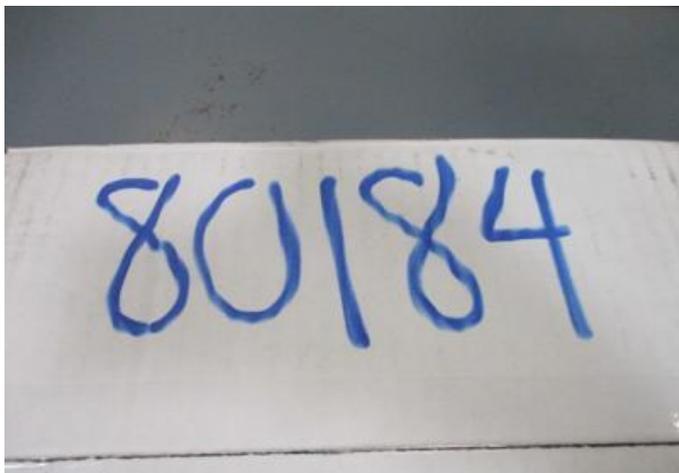

Our provision of advice, assistance or guidance on the appropriate packaging of shipment does not constitute acceptance of liability, unless such advice, assistance or guidance is in writing from the FedEx Packaging Lab and expressly accepts liability in the event of a damaged shipment.



Our provision of advice, assistance or guidance on the appropriate packaging of shipment does not constitute acceptance of liability, unless such advice, assistance or guidance is in writing from the FedEx Packaging Lab and expressly accepts liability in the event of a damaged shipment.

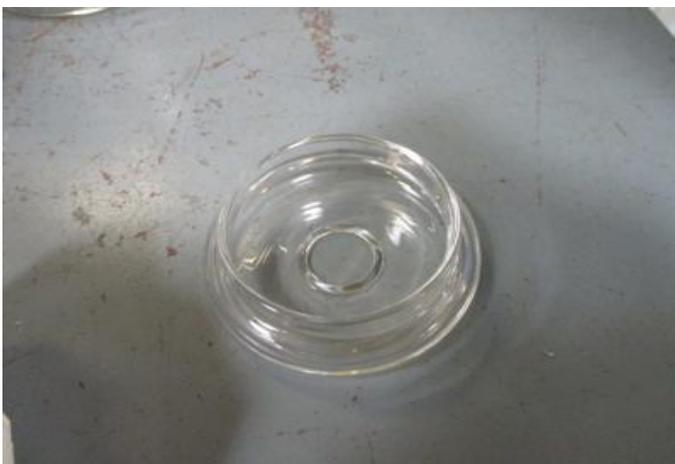

---

Our provision of advice, assistance or guidance on the appropriate packaging of shipment does not constitute acceptance of liability, unless such advice, assistance or guidance is in writing from the FedEx Packaging Lab and expressly accepts liability in the event of a damaged shipment.